

# 3M Speedglas™ Auto-Darkening Welding Helmets

## User Instructions for:

- **Utility**
- **9000XF**
- **9002D**
- **9002V**
- **9002X**

Important: Keep these *User Instructions* for reference.

# Masques pour soudeurs avec filtre à lentille photosensible Speedglas™

## Directives d'utilisation pour les masques :

- «*Utility*»
- **9000XF**
- **9002D**
- **9002V**
- **9002X**

Important : Conserver ces *directives* à titre de référence.

# Caretas con lente auto-oscurecente para soldadura Speedglas™

## Instrucciones para:

- **Utility**
- **9000XF**
- **9002D**
- **9002V**
- **9002X**

Importante: Conserve estas *Instrucciones* para referencia futura.

<b>▲ WARNING</b>	
These products are designed to help protect the wearer's eyes from harmful radiation including visible light, ultra-violet radiation (UV) and infra-red radiation (IR) resulting from certain arc and gas welding processes when used in accordance with these <i>User Instructions</i> . Use of this product in any other application or welding process that require shade #14 or higher filters may result in <b>permanent eye injury and vision loss</b> . Do not use any welding product without appropriate training for proper use. See supervisor for use. See CAN/CSA C 226.1-01 (U.S.A. 1-800-243-4630), or Canada, call Technical Service at 1-800-267-4414.	<b>SPECIFICATIONS</b> ADF Switching time Less than 0.15 milliseconds (9002 V and X) 0.4 milliseconds (9002D) 0.65 milliseconds (Utility, 9000F and XF)
Always wear ANSI Z87.1-2003 compliant safety spectacles in addition to any welding helmet. Failure to do so may result in <b>permanent eye injury and vision loss</b> . In Canada, follow CSA Z26.1 and/or the requirements of the authority having jurisdiction in your region.	ADF Light state ADF Off state ADF Ultraviolet/Infrared Dark Shades
Before each use, perform the inspection described in these <i>User Instructions</i> to ensure that all components are installed and functioning as intended. Use of 3M™ welding helmet assemblies that do not meet the inspection requirements may result in <b>permanent eye injury and vision loss</b> .	Weight Area: Utility, 9000, 9002D, 9002V, 9002X 9000F, 9000XF, 9000WR, 9000HWR, 9002V, 9002X 9002D, 9002X: 4.09" x 12.1" (104 mm x 54 mm)
Do not use welding filters that are cracked, pitted or otherwise damaged as these conditions may compromise eye impact protection and may allow harmful UV and IR radiation to pass through causing <b>permanent eye injury and vision loss</b> .	Viewing Area: Utility / 9000 9000 FV 9000 HWR 9000 HWR FV ProtoP ProtoP FV ScanWindows add 13 g or 0.03 lbs. to the above
Shield the 3M™ Speedglas™ "Auto Darkening Filter (ADF) fast to switch to dark mode upon striking an arc, stop welding immediately and inspect the ADF as described in these <i>User Instructions</i> . Continued use of an ADF that fails to switch to the dark state may result in <b>permanent eye injury and vision loss</b> . If the problem cannot be identified and corrected, do not use the ADF; contact your supervisor or 3M for assistance.	Weight of Helmets - No ADF Utility / 9000 9000 FV 9000 HWR 9000 HWR FV ProtoP ProtoP FV ScanWindows add 13 g or 0.03 lbs. to the above
<b>Severe burn injuries may result</b> if these welding helmets are used for heavy-duty overhead welding applications where there is a potential for falling molten metal.	Regular size (Utility, 9002D, 9000V) Operator's temperature 23°F to 131°F (-5°C to +55°C) Battery Type: Two CR-2032 lithium 3V batteries Battery Life: Utility, 9000, 9002D & 9002V 9000XF: 9002X: 9002D: 2000 hours 9000F: 9000HWR: 9000HWR FV: ProtoP: ProtoP FV: ScanWindows add 13 g or 0.03 lbs. to the above

**GENERAL SAFETY INFORMATION**  
This product conforms to no components made from natural rubber latex.

**Intended Use**  
The 3M™ Speedglas™ "Auto-Darkening Welding Helmets are designed to help protect the wearer's eyes from harmful radiation including visible light, ultra-violet radiation (UV) and infrared radiation (IR) resulting from certain arc and gas welding processes when used in accordance with these *User Instructions*. Two eye-level sensors on the front of 3M™ Speedglas™ "Auto-Darkening filters (ADFs) read independently at the moment the welding arc is struck and cause the filter to darken. The ADF switches back to the light shade state as soon as the welding arc has stopped. ADFs can also be used for gas welding (oxy-acetylene) when the filter is in the "OFF" state, shade 5-6. Two lithium batteries are used as the power source. The ADF will switch off automatically 30 to 40 minutes after the last arc is detected. Protection from ultra-violet radiation (UV) and infrared radiation (IR) continues, whether the ADF is in the light or the dark state. In the event of a battery failure, the welder remains protected against UV and IR radiation according to the darkest shade (shade 13). 3M™ Speedglas™ ADFs allow the welder to view their work clearly and safely during set up, during the weld and after without interruption and without the burden or delay of manually lifting the shield or filter. ADFs allow manual arc welding to be performed more quickly and accurately in comparison to traditional passive welding filter plates.

**3M™ Speedglas™** "Auto-Darkening Welding Helmets feature performance-optimized designed vents to help exhaust heat and reduce inside the welding helmet. The 3M™ Speedglas™ "Utility Helmet is not equipped with exhaust vents.

3M™ Speedglas™ "FlexView Helmets have an additional mechanism that allows the ADF to be lifted, exposing a 4" x 3" x 3" (102 mm x 76 mm) clear polycarbonate lens. The clear lens meets ANSI Z87.1-2003 requirements for eye and face impact protection, making it suitable for chipping, grinding and pressure weld preparation. A spring holds the ADF secure on top of the helmet while not in use.

**USE INSTRUCTIONS AND LIMITATIONS**  
**Important Use Limitations:**  
This product does not provide any protection from respiratory hazards that may result from welding processes or from other sources. 3M™ Speedglas™ "Welding Helmets may be worn in conjunction with certain respiratory models. For more information about respiratory protection for welders, contact your local Safety Service at 1-800-243-4630 in Canada, call Technical Service at 1-800-267-4414.

3M™ Speedglas™ "ADFs are not suitable for laser welding or welding processes that require shade 14 or higher filters. Use of this product for these applications may result in **permanent eye injury and vision loss**.

Only operate the ADF at temperatures between 23°F to 131°F (-5°C to +55°C). If used outside of this range, the filter may not perform as designed and may result in **permanent eye injury and vision loss**.

<b>▲ WARNING</b>	
These products are designed to help protect the wearer's eyes from harmful radiation including visible light, ultra-violet radiation (UV) and infra-red radiation (IR) resulting from certain arc and gas welding processes when used in accordance with these <i>User Instructions</i> . Use of this product in any other application or welding process that require shade #14 or higher filters may result in <b>permanent eye injury and vision loss</b> . Do not use any welding product without appropriate training for proper use. See supervisor for use. See CAN/CSA C 226.1-01 (U.S.A. 1-800-243-4630), or Canada, call Technical Service at 1-800-267-4414.	<b>SPECIFICATIONS</b> ADF Switching time Less than 0.15 milliseconds (9002 V and X) 0.4 milliseconds (9002D) 0.65 milliseconds (Utility, 9000F and XF)
Always wear ANSI Z87.1-2003 compliant safety spectacles in addition to any welding helmet. Failure to do so may result in <b>permanent eye injury and vision loss</b> . In Canada, follow CSA Z26.1 and/or the requirements of the authority having jurisdiction in your region.	ADF Light state ADF Off state ADF Ultraviolet/Infrared Dark Shades
Before each use, perform the inspection described in these <i>User Instructions</i> to ensure that all components are installed and functioning as intended. Use of 3M™ welding helmet assemblies that do not meet the inspection requirements may result in <b>permanent eye injury and vision loss</b> .	Weight Area: Utility, 9000, 9002D, 9002V, 9002X 9000F, 9000XF, 9000WR, 9000HWR, 9002V, 9002X 9002D, 9002X: 4.09" x 12.1" (104 mm x 54 mm)
Do not use welding filters that are cracked, pitted or otherwise damaged as these conditions may compromise eye impact protection and may allow harmful UV and IR radiation to pass through causing <b>permanent eye injury and vision loss</b> .	Viewing Area: Utility / 9000 9000 FV 9000 HWR 9000 HWR FV ProtoP ProtoP FV ScanWindows add 13 g or 0.03 lbs. to the above
<b>Severe burn injuries may result</b> if these welding helmets are used for heavy-duty overhead welding applications where there is a potential for falling molten metal.	Regular size (Utility, 9002D, 9000V) Operator's temperature 23°F to 131°F (-5°C to +55°C) Battery Type: Two CR-2032 lithium 3V batteries Battery Life: Utility, 9000, 9002D & 9002V 9000XF: 9002X: 9002D: 2000 hours 9000F: 9000HWR: 9000HWR FV: ProtoP: ProtoP FV: ScanWindows add 13 g or 0.03 lbs. to the above

**GENERAL SAFETY INFORMATION**  
This product conforms to no components made from natural rubber latex.

**Intended Use**  
The 3M™ Speedglas™ "Auto-Darkening Welding Helmets are designed to help protect the wearer's eyes from harmful radiation including visible light, ultra-violet radiation (UV) and infrared radiation (IR) resulting from certain arc and gas welding processes when used in accordance with these *User Instructions*. Two eye-level sensors on the front of 3M™ Speedglas™ "Auto-Darkening filters (ADFs) read independently at the moment the welding arc is struck and cause the filter to darken. The ADF switches back to the light shade state as soon as the welding arc has stopped. ADFs can also be used for gas welding (oxy-acetylene) when the filter is in the "OFF" state, shade 5-6. Two lithium batteries are used as the power source. The ADF will switch off automatically 30 to 40 minutes after the last arc is detected. Protection from ultra-violet radiation (UV) and infrared radiation (IR) continues, whether the ADF is in the light or the dark state. In the event of a battery failure, the welder remains protected against UV and IR radiation according to the darkest shade (shade 13). 3M™ Speedglas™ ADFs allow the welder to view their work clearly and safely during set up, during the weld and after without interruption and without the burden or delay of manually lifting the shield or filter. ADFs allow manual arc welding to be performed more quickly and accurately in comparison to traditional passive welding filter plates.

**3M™ Speedglas™** "Auto-Darkening Welding Helmets feature performance-optimized designed vents to help exhaust heat and reduce inside the welding helmet. The 3M™ Speedglas™ "Utility Helmet is not equipped with exhaust vents.

3M™ Speedglas™ "FlexView Helmets have an additional mechanism that allows the ADF to be lifted, exposing a 4" x 3" x 3" (102 mm x 76 mm) clear polycarbonate lens. The clear lens meets ANSI Z87.1-2003 requirements for eye and face impact protection, making it suitable for chipping, grinding and pressure weld preparation. A spring holds the ADF secure on top of the helmet while not in use.

**USE INSTRUCTIONS AND LIMITATIONS**  
**Important Use Limitations:**  
This product does not provide any protection from respiratory hazards that may result from welding processes or from other sources. 3M™ Speedglas™ "Welding Helmets may be worn in conjunction with certain respiratory models. For more information about respiratory protection for welders, contact your local Safety Service at 1-800-243-4630 in Canada, call Technical Service at 1-800-267-4414.

3M™ Speedglas™ "ADFs are not suitable for laser welding or welding processes that require shade 14 or higher filters. Use of this product for these applications may result in **permanent eye injury and vision loss**.



Only operate the ADF at temperatures between 23°F to 131°F (-5°C to +55°C). If used outside of this range, the filter may not perform as designed and may result in **permanent eye injury and vision loss**.

## ADJUSTMENT OF HELMET & VIEWING POSITION

1) Adjust the overhead band to one of the adjusted positions for proper shield depth and to ensure comfort and stability (Fig. 1). The headband also has a ratchet band to allow or decrease circumference.

2) Check for proper viewing position. The recommended viewing angle between the face and shield is 10° to 12° (Fig. 2). To adjust viewing angle, follow step 5.

3) Position the headband pivot stop on the peg on the side of the welding helmet (Fig. 3) push through one of the slots in the stop to obtain the desired viewing angle.

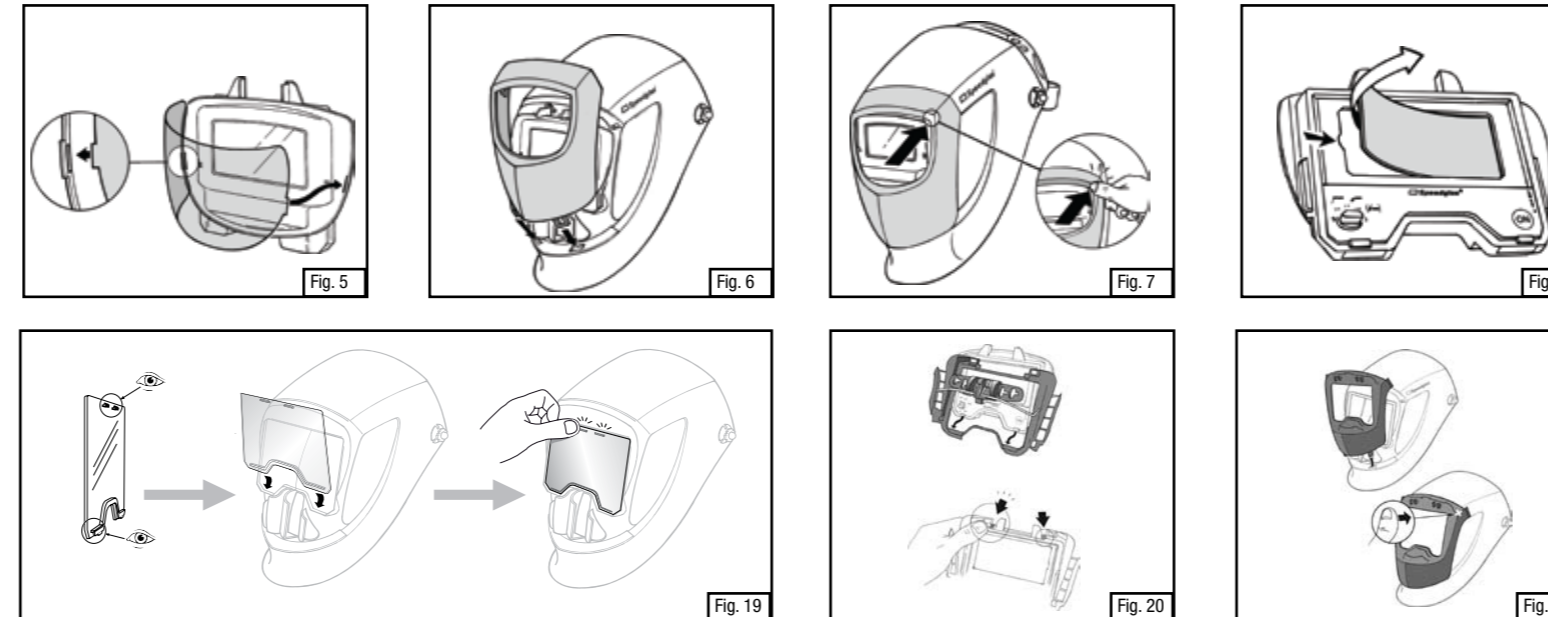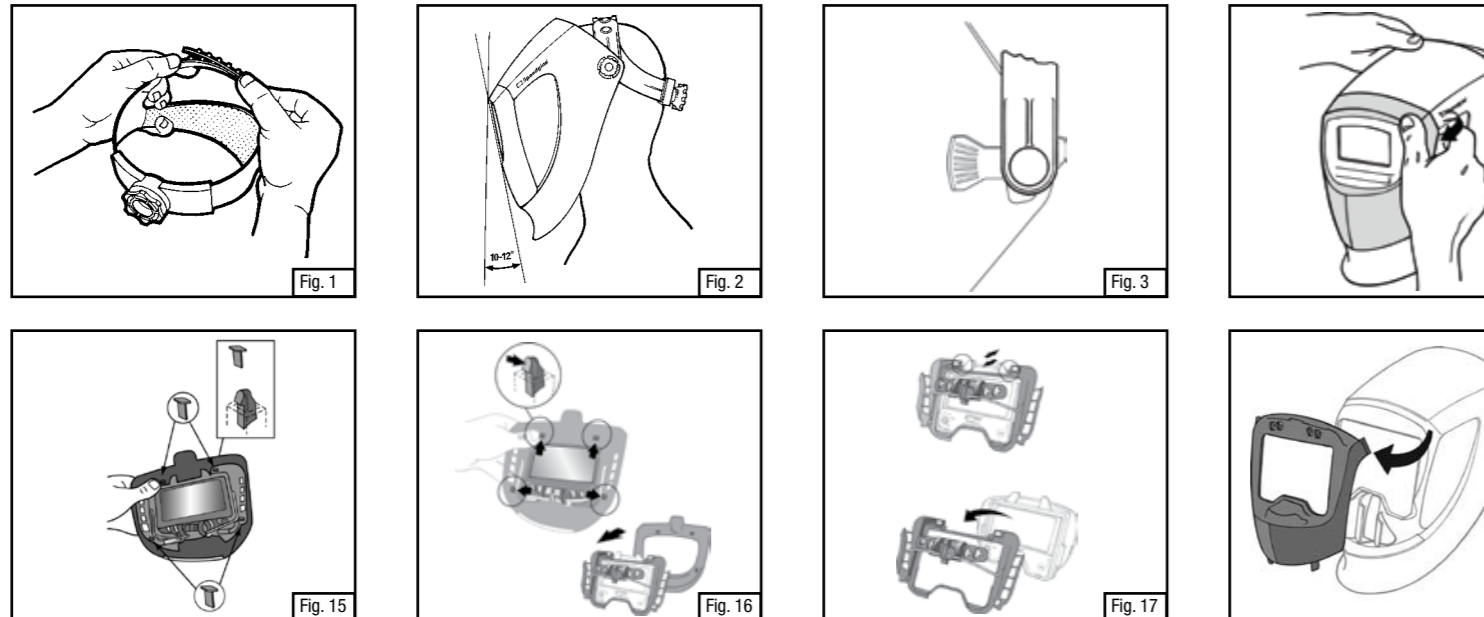

**ADF OPERATION**  
**Turn/Off Operation**  
To turn the ADF on, simply press the ON button. The ADF automatically turns off 60 minutes after the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

**Dark Shade Selection (9002D, 9002V and 9002X only)**  
The five different dark shade levels are available to the user: 9, 10, 11, 12 & 13, depending on the ADF model. Check with the Shade Guide below to determine the proper dark shade setting for your application. In order to see which shade the welding filter is currently set to, momentarily press the shade button. To select another shade, keep pressing the shade button while the LED is flashing until the LED indicates the desired setting.

**9002V and X:**  
Position 1 Low sensitivity - for welding in groups.  
Position 2 Normal sensitivity - for typical SMAW, MIG and TIG welding indoors and outdoors.  
Position 3 High sensitivity - for low current or stable arcs (e.g. TIG welding in low amps).  
Position 4 Very high sensitivity - for very low current, stable arcs and partially blocked arcs.

**9002V and X:**  
Position 1 Low sensitivity - for welding in groups.  
Position 2 Normal sensitivity - for typical SMAW, MIG and TIG welding indoors and outdoors.  
Position 3 High sensitivity - for low current or stable arcs (e.g. TIG welding in low amps).  
Position 4 Very high sensitivity - for very low current, stable arcs and partially blocked arcs.

**Low:** Normal sensitivity - for typical SMAW, MIG and TIG welding indoors and outdoors.  
**High:** High sensitivity - for low current or stable arcs (e.g. TIG welding in low amps).

**Finding the right sensitivity setting (9002V and X ADFs)**  
In order to find a suitable sensitivity setting, start with setting 2. This is the correct setting for most applications. If the filter does not darken reliably while welding, change to setting 3 or 4 until reliable switching is achieved. If the sensitivity is set too high, the filter might switch to the dark state in response to ambient lighting. If the ADF is being used in close proximity to other welding arcs, it may be necessary to switch to position 1 to avoid interference or "false triggering."

**Setting the Delay**  
The delay setting controls the speed with which the filter returns to the light state after welding has stopped. In order to see which position it currently set to, momentarily press the delay button. To set a desired setting, keep pressing the delay button while the LED is flashing until the LED indicates the desired setting.

**Position 1** Fast recovery to light state - for spot or tack welding where the welder needs to have a clear view quickly after finishing the weld.

**Position 1** Normal position.

**Position 4** Delayed recovery to light state - for high amperage applications where bright weld pools often occur before visioning.

**Gas Welding and Cutting**  
3M™ Speedglas™ "ADFs can be used for gas welding and cutting when in the OFF state. The ADF is shade 5 when OFF.

**Replacing the Outer Protection Plate**  
1) Remove the silver front panel by pulling one of its upper corners away from the shield (Fig. 4). Lift out the ADF protection plate.

**▲ WARNING**  
Before each use, perform the inspection described in these *User Instructions* to ensure that all components are installed and functioning as intended. Use of 3M™ welding helmet assemblies that do not meet the inspection requirements or failure to use genuine 3M™ Speedglas™ "replacement parts may result in permanent eye injury and vision loss.

Do not use welding filters that are cracked, pitted or otherwise damaged as these conditions may compromise eye impact protection and may allow harmful UV and IR radiation to pass through causing permanent eye injury and vision loss.

**Check for Proper ADF Conditions**  
Under normal lighting conditions (not welding), look through the ADF and press the ON button. The ADF should go from the light state to the dark state in 1/10th of a second. The ADF should not turn light, replace the batteries and re-test. Optionally, the ADF can be observed switching between light and dark protection plates, place the masking plate in front of the ADF cassette, and then re-install the outer protection plate and silver front panel. No special adapter or retainer is needed.


**NOTE:** Do NOT use masking plates that do not fit under the outer protection plate. The outer protection plate MUST be fully seated with its two tabs inserted into the ADF's two slots (Fig. 5).

**Removing the ADF Cassette/Changing the Batteries**  
Batteries should be replaced when the ADF does not turn noticeably lighter (shade 5 to 3) when switched on. In addition, all 9002 models have a low battery indicator that will flash repeatedly when the battery should be replaced. To change batteries, remove the silver front panel and then remove the ADF cassette from the helmet by equalizing the ADF cassette with the ADF. Pull the ADF cassette out of the bottom of the ADF cassette. There are three battery compartments. Carefully open the compartments using a small flathead screwdriver. The battery holders slide straight out; do not use excessive force nor insert the screwdriver further than necessary when opening the compartments. Remove the batteries and dispose of them according to local regulations. Insert the new batteries (type CR-2032, 3M™ Speedglas™ part no. DA-0320-00) into the battery holders (Fig. 11). Push the holders into the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

**Check for Proper ADF Conditions**  
Under normal lighting conditions (not welding), look through the ADF and press the ON button. The ADF should go from the light state to the dark state in 1/10th of a second. The ADF should not turn light, replace the batteries and re-test. Optionally, the ADF can be observed switching between light and dark protection plates, place the masking plate in front of the ADF cassette, and then re-install the outer protection plate and silver front panel. No special adapter or retainer is needed.

**NOTE:** Do NOT use masking plates that do not fit under the outer protection plate. The outer protection plate MUST be fully seated with its two tabs inserted into the ADF's two slots (Fig. 5).

**Removing the ADF Cassette/Changing the Batteries**  
Batteries should be replaced when the ADF does not turn noticeably lighter (shade 5 to 3) when switched on. In addition, all 9002 models have a low battery indicator that will flash repeatedly when the battery should be replaced. To change batteries, remove the silver front panel and then remove the ADF cassette from the helmet by equalizing the ADF cassette with the ADF. Pull the ADF cassette out of the bottom of the ADF cassette. There are three battery compartments. Carefully open the compartments using a small flathead screwdriver. The battery holders slide straight out; do not use excessive force nor insert the screwdriver further than necessary when opening the compartments. Remove the batteries and dispose of them according to local regulations. Insert the new batteries (type CR-2032, 3M™ Speedglas™ part no. DA-0320-00) into the battery holders (Fig. 11). Push the holders into the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

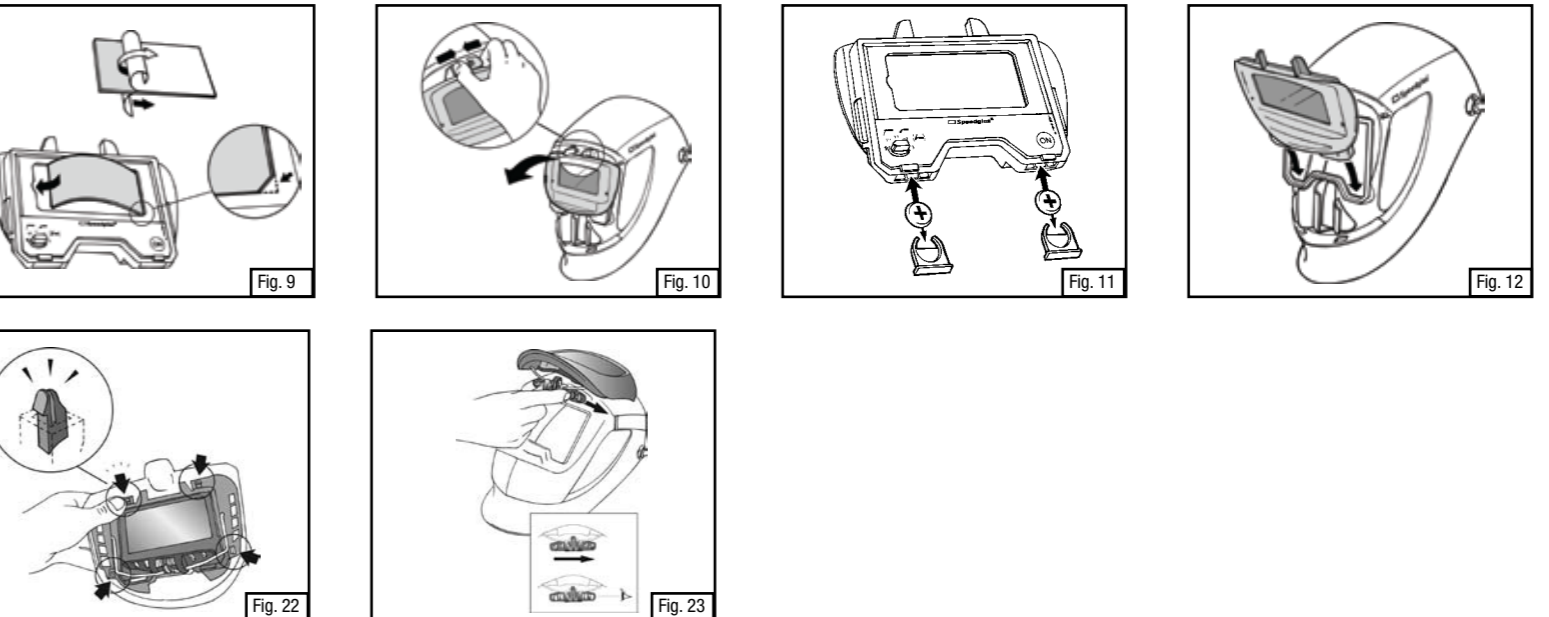

**CLEANING AND STORAGE**  
Clean the welding helmet with mild soap and lukewarm water. Do not use solvents. Clean the welding filter with a clean, lint-free tissue or cloth. Do not remove ADFs or water or spray directly on liquids. Store equipment in a clean dry and dust-free environment at room temperature.

**Table 1. Recommended Guide for Shade Numbers (Adapted from ANSI Z84.1-2000)**

Operation	Electrode diameter (mm)	Arc current, amps	Minimum Protective Shade	Recommended Shade Number
Shielded metal arc	< 3	< 60	7	10
	3-5	60-160	8	10
	5-8	160-250	10	12
	> 8	250-350	11	14
	> 8	> 350	12	14
Gas-metal-arc welding	< 60	< 60	7	10
	60-160	60-160	10	12
Gas-tungsten-arc	< 50	< 50	8	10
	50-150	50-150	8	12
Air-carbon-arc cutting	< 50	< 50	10	12
	50-1000	500-1000	11	14
Plasma-arc welding	< 25	< 25	6	8
	25-100	100-400	10	12
Plasma-arc cutting	< 300	< 300	8	9
	300-400	400-800	10	12
Torch brazing	< 300	< 300	8	9
	300-400	400-800	10	12
Torch soldering	< 300	< 300	8	9
	300-400	400-800	10	12
Carbon arc welding	< 300	< 300	8	9
	300-400	400-800	10	12

**▲ WARNING**  
Before each use, perform the inspection described in these *User Instructions* to ensure that all components are installed and functioning as intended. Use of 3M™ welding helmet assemblies that do not meet the inspection requirements or failure to use genuine 3M™ Speedglas™ "replacement parts may result in permanent eye injury and vision loss.

Do not use welding filters that are cracked, pitted or otherwise damaged as these conditions may compromise eye impact protection and may allow harmful UV and IR radiation to pass through causing permanent eye injury and vision loss.

**Check for Proper ADF Conditions**  
Under normal lighting conditions (not welding), look through the ADF and press the ON button. The ADF should go from the light state to the dark state in 1/10th of a second. The ADF should not turn light, replace the batteries and re-test. Optionally, the ADF can be observed switching between light and dark protection plates, place the masking plate in front of the ADF cassette, and then re-install the outer protection plate and silver front panel. No special adapter or retainer is needed.

**NOTE:** Do NOT use masking plates that do not fit under the outer protection plate. The outer protection plate MUST be fully seated with its two tabs inserted into the ADF's two slots (Fig. 5).

**Removing the ADF Cassette/Changing the Batteries**  
Batteries should be replaced when the ADF does not turn noticeably lighter (shade 5 to 3) when switched on. In addition, all 9002 models have a low battery indicator that will flash repeatedly when the battery should be replaced. To change batteries, remove the silver front panel and then remove the ADF cassette from the helmet by equalizing the ADF cassette with the ADF. Pull the ADF cassette out of the bottom of the ADF cassette. There are three battery compartments. Carefully open the compartments using a small flathead screwdriver. The battery holders slide straight out; do not use excessive force nor insert the screwdriver further than necessary when opening the compartments. Remove the batteries and dispose of them according to local regulations. Insert the new batteries (type CR-2032, 3M™ Speedglas™ part no. DA-0320-00) into the battery holders (Fig. 11). Push the holders into the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

**Check for Proper ADF Conditions**  
Under normal lighting conditions (not welding), look through the ADF and press the ON button. The ADF should go from the light state to the dark state in 1/10th of a second. The ADF should not turn light, replace the batteries and re-test. Optionally, the ADF can be observed switching between light and dark protection plates, place the masking plate in front of the ADF cassette, and then re-install the outer protection plate and silver front panel. No special adapter or retainer is needed.


**NOTE:** Do NOT use masking plates that do not fit under the outer protection plate. The outer protection plate MUST be fully seated with its two tabs inserted into the ADF's two slots (Fig. 5).

**Removing the ADF Cassette/Changing the Batteries**  
Batteries should be replaced when the ADF does not turn noticeably lighter (shade 5 to 3) when switched on. In addition, all 9002 models have a low battery indicator that will flash repeatedly when the battery should be replaced. To change batteries, remove the silver front panel and then remove the ADF cassette from the helmet by equalizing the ADF cassette with the ADF. Pull the ADF cassette out of the bottom of the ADF cassette. There are three battery compartments. Carefully open the compartments using a small flathead screwdriver. The battery holders slide straight out; do not use excessive force nor insert the screwdriver further than necessary when opening the compartments. Remove the batteries and dispose of them according to local regulations. Insert the new batteries (type CR-2032, 3M™ Speedglas™ part no. DA-0320-00) into the battery holders (Fig. 11). Push the holders into the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

**Check for Proper ADF Conditions**  
Under normal lighting conditions (not welding), look through the ADF and press the ON button. The ADF should go from the light state to the dark state in 1/10th of a second. The ADF should not turn light, replace the batteries and re-test. Optionally, the ADF can be observed switching between light and dark protection plates, place the masking plate in front of the ADF cassette, and then re-install the outer protection plate and silver front panel. No special adapter or retainer is needed.

**NOTE:** Do NOT use masking plates that do not fit under the outer protection plate. The outer protection plate MUST be fully seated with its two tabs inserted into the ADF's two slots (Fig. 5).

**Removing the ADF Cassette/Changing the Batteries**  
Batteries should be replaced when the ADF does not turn noticeably lighter (shade 5 to 3) when switched on. In addition, all 9002 models have a low battery indicator that will flash repeatedly when the battery should be replaced. To change batteries, remove the silver front panel and then remove the ADF cassette from the helmet by equalizing the ADF cassette with the ADF. Pull the ADF cassette out of the bottom of the ADF cassette. There are three battery compartments. Carefully open the compartments using a small flathead screwdriver. The battery holders slide straight out; do not use excessive force nor insert the screwdriver further than necessary when opening the compartments. Remove the batteries and dispose of them according to local regulations. Insert the new batteries (type CR-2032, 3M™ Speedglas™ part no. DA-0320-00) into the battery holders (Fig. 11). Push the holders into the last arc is detected (UV and IR OFF modes). The ADF can also be turned off manually by pressing the ON button for two seconds. The 9002D, 9002V and 9002X ADFs have an extra feature: after each start-up sequence, the current settings (shade, sensitivity and delay) are displayed by flashing LEDs.

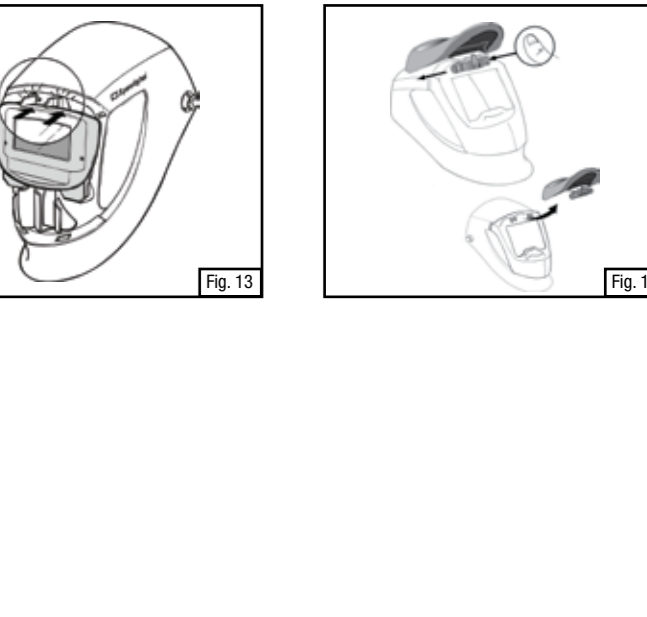

**▲ MISE EN GARDE**  
Lorsqu'on les utilise en suivant les présentes *directives d'utilisation*, ces masques visent à protéger les yeux contre les rayonnements nocifs, notamment la lumière visible, les ultraviolets et les infrarouges, ainsi que certains procédés de soudage à l'arc au gaz. L'utilisation de ces masques pour d'autres procédés de soudage, comme le soudage au laser ou le soudage nécessitant un filtre de lentille minimale 14, peut provoquer des blessures oculaires permanentes et une perte de vision. Ne pas utiliser de produit pour le soudage sans avoir reçu la formation nécessaire. Pour tout renseignement sur l'utilisation adéquate de ce produit, consultez nos experts. Les directives de sécurité ne sont pas des pièces d'origine Speedglas™. 3M™ peut cesser des blessures oculaires permanentes et une perte de vision. Au Canada, se conformer à la norme 234.3 de la CSA ou aux exigences de l'Installation complète de la région.

Avant chaque utilisation, effectuer l'inspection décrite dans les présentes *directives d'utilisation* pour s'assurer que les composants sont installés et fonctionnent correctement. L'utilisation de masques pour soudeurs 3M™ qui ne répondent pas à ces exigences d'inspection ou dont les pièces ou les composants ne sont pas des pièces d'origine Speedglas™ peut provoquer des blessures oculaires permanentes et une perte de vision. Ne pas utiliser de produit pour le soudage sans avoir reçu la formation nécessaire. Pour tout renseignement sur l'utilisation adéquate de ce produit, consultez nos experts. Les directives de sécurité ne sont pas des pièces d'origine Speedglas™. 3M™ peut cesser des blessures oculaires permanentes et une perte de vision. Au Canada, se conformer à la norme 234.3 de la CSA ou aux exigences de l'Installation complète de la région.

Avant chaque utilisation, effectuer l'inspection décrite dans les présentes *directives d'utilisation* pour s'assurer que les composants sont installés et fonctionnent correctement. L'utilisation de masques pour soudeurs 3M™ qui ne répondent pas à ces exigences d'inspection ou dont les pièces ou les composants ne sont pas des pièces d'origine Speedglas™ peut provoquer des blessures oculaires permanentes et une perte de vision. Ne pas utiliser de produit pour le soudage sans avoir reçu la formation nécessaire. Pour tout renseignement sur l'utilisation adéquate de ce produit, consultez nos experts. Les directives de sécurité ne sont pas des pièces d'origine Speedglas™. 3M™ peut cesser des blessures oculaires permanentes et une perte de vision. Au Canada, se conformer à la norme 234.3 de la CSA ou aux exigences de l'Installation complète de la région.

Avant chaque utilisation, effectuer l'inspection décrite dans les présentes *directives d'utilisation* pour s'assurer que les composants sont installés et fonctionnent correctement. L'utilisation de masques pour soudeurs 3M™ qui ne répondent pas à ces exigences d'inspection ou dont les pièces ou les composants ne sont pas des pièces d'origine Speedglas™ peut provoquer des blessures oculaires permanentes et une perte de vision. Ne pas utiliser de produit pour le soudage sans avoir reçu la formation nécessaire. Pour tout renseignement sur l'utilisation adéquate de ce produit, consultez nos experts. Les directives de sécurité ne sont pas des pièces d'origine Speedglas™. 3M™ peut cesser des blessures oculaires permanentes et une perte de vision. Au Canada, se conformer à la norme 234.3 de la CSA ou aux exigences de l'Installation complète de la région.

<b>▲ MISE EN GARDE</b>	
When you use them following the present <i>usage instructions</i> , these masks are designed to protect your eyes from harmful radiation including visible light, ultraviolet radiation (UV) and infrared radiation (IR) resulting from certain arc and gas welding processes when used in accordance with these <i>User Instructions</i> . Use of this product in any other application or welding process that require shade #14 or higher filters may result in <b>permanent eye injury and vision loss</b> . Do not use any welding product without appropriate training for proper use. See supervisor for use. See CAN/CSA C 226.1-01 (U.S.A. 1-800-243-4630), or Canada, call Technical Service at 1-800-267-4414.	<b>SPECIFICATIONS</b> Delay of obscuration of the filter to a lensible photosensitive 0.5 milliseconds (models 9002V et X) 0.4 milliseconds (modèle 9002D) 0.65 milliseconds (modèles -Utility-, 9000F et XF) Teinte plus sombre que la lentille photosensible Teinte 5 ou 6 Fonction marche/arrêt Protection permanente, sans obscurcissement Tentes foncées
Always wear ANSI Z87.1-2003 compliant safety spectacles in addition to any welding helmet. Failure to do so may result in <b>permanent eye injury and vision loss</b> . In Canada, follow CSA Z26.1 and/or the requirements of the authority having jurisdiction in your region.	-Utility- / 10 ou 11 9002D / 10 et 11 ou 12 9002V et X / 9, 10, 11, 12 et 13 9002X / 9, 10, 11, 12 et 13 9002D et 9002X: 91 mm x 43 mm (3.6" x 1.68 po) 9002V et 9000F: 104 mm x 54 mm (4.09" x 2.13 po) 9002X et 9000F: 104 mm x 54 mm (4.09" x 2.13 po)
Before each use, perform the inspection described in these <i>User Instructions</i> to ensure that all components are installed and functioning as intended. Use of 3M™ welding helmet assemblies that do not meet the inspection requirements may result in <b>permanent eye injury and vision loss</b> .	Fendré : Utility / 9000 9000 FV 9000 HWR 9000 HWR FV ProtoP ProtoP FV ScanWindows add 13 g or 0.03 lbs. to the above
Do not use welding filters that are cracked, pitted or otherwise damaged as these conditions may compromise eye impact protection and may allow	

**ADVERTENCIA**  
 Estos productos están diseñados para ayudar a proteger los ojos del usuario contra radiación dañina, como luz visible, radiación ultravioleta (UV) y radiación infrarroja (IR), ocasionadas por ciertos procesos de soldadura por arco y gas, cuando se utilizan de acuerdo con estas Instrucciones. El uso de este producto para cualquier otra aplicación, como la soldadura con láser o soldadura que requiera lentes con sombra 14 o mayor, puede ocasionar lesiones permanentes en los ojos y pérdida de la vista. No use ningún producto para soldadura si aún continúa con la capacitación adecuada. Para su uso adecuado consulte a su supervisor, lea las Instrucciones o llame a 3M en EE.UU. al 1-800-248-6030. En Canadá llame al Servicio Técnico al 1-800-287-4414. En México llame al 01-800-712-0646.  
 Siempre use gafas de seguridad que cumplan con la norma ANSI Z87.1-2003 junto con cualquier correa para soldadura. No hacerlo puede ocasionar lesiones permanentes en los ojos y pérdida de la vista. En Canadá, debe cumplir con los requerimientos de la norma CSA Z94.3 de la autoridad de jurisdicción en su región.  
 Antes de cada uso, realice una inspección de acuerdo con las Instrucciones de uso para asegurarse que todos los componentes están instalados y que funcionan de manera adecuada. El uso de ensamblajes de Carcasa para soldadura 3M™ que no cumplan con estos requerimientos de inspección y que no incluyan partes de repuesto originales Speedglas™ 3M™ puede ocasionar lesiones permanentes en los ojos o pérdida de la vista.  
 No use las lentes para soldadura si están rotas, pinchadas o dañadas, ya que estas condiciones pueden comprometer la protección ocular y facial contra impactos y puede permitir el paso de radiación UV e IR dañina, lo que ocasionaría lesiones en los ojos y pérdida de la vista.  
 Si el Lente auto-oscuriente (ADF) Speedglas™ 3M™ no cambia a modo oscuro o permanece en modo oscuro por un tiempo demasiado largo, o si se oscurece demasiado pronto, deténgase y revise el ADF como se indica en estas Instrucciones. Si usa un control de modo de ADF, asegure que el cambio a modo oscuro puede resultar en lesiones permanentes de los ojos y pérdida de la vista. Si no puede identificar o corregir el problema, no use el ADF; contacte a su supervisor o a 3M para solicitar ayuda.  
 Existe el riesgo de quemaduras graves si las carcasas se usan para aplicaciones por encima de la cabeza de uso rudo donde hay una posibilidad de que caiga metal fundido.  
 Solo use estos ADFs en temperaturas entre -5°C (23°F) y +55°C (131°F). Si los usa fuera de este rango, es posible que su desempeño no sea el óptimo, lo que puede ocasionar lesiones permanentes en los ojos y pérdida de la vista.

**INFORMACIÓN GENERAL SOBRE SEGURIDAD**  
 Este producto no contiene hechos de látex de hule natural.


Las Carcasas con lente auto-oscuriente Speedglas™ 3M™ están diseñadas para ayudar a proteger los ojos del usuario contra radiación dañina, como luz visible, radiación ultravioleta (UV) y radiación infrarroja (IR), ocasionadas por ciertos procesos de soldadura por arco y gas, cuando se utilizan de acuerdo con estas Instrucciones. Lea los dos folletos al nivel de los ojos ubicados al frente de los Lentes auto-oscurientes (ADF) Speedglas™ 3M™ reaccionan independientemente al momento de iniciar el proceso de soldadura por arco, lo que hace que el lente se oscurezca. El ADF muestra la sombra clara (sombra 3) tan pronto termina el proceso de soldadura por arco. Los ADFs también pueden utilizarse para soldadura con gas (ox-acetileno) cuando el lente está en estado apagado (OFF), sombra 3-6. Como fuente de energía se utilizan dos baterías de litio. El ADF se apagará automáticamente 30 a 60 minutos después de detectar el último arco. La protección contra radiación ultravioleta (UV) e infrarroja (IR) es continua, ya sea que el ADF esté en el estado de sombra clara o oscura. En caso de que haya una falta de batería o electrónica, el soldador sigue protegido contra la radiación UV e IR de acuerdo con la sombra más oscura (sombra 13).

Los ADFs Speedglas™ 3M™ permiten al soldador ver con claridad y seguridad su trabajo durante la instalación, la soldadura y después sin interrupción y sin la preocupación o el retraso de levantar con la mano el visor o el lente. Los ADFs permiten la soldadura por arco manual con más rapidez y precisión en comparación con las lentes para soldadura tradicionales.

Las Carcasas Speedglas™ 3M™ Serie 9000 cuentan con ventilaciones patentadas con diseño aerodinámico para ayudar a enfriar el área ocular y reducir la saturación dentro de la carcasa. La Carcasa Speedglas™ 3M™ Utility 3M™ no está equipada con ventilaciones de extracción.

Las Carcasas Speedglas™ FlexView 3M™ cuentan con un mecanismo adicional que permite el levantamiento del ADF, lo que deja expuesto un lente transparente de policarbonato de 120 mm x 92 mm (4.72" x 3.61"). El lente transparente cumple con los requerimientos de la norma ANSI Z87.1-2003 para protección ocular y facial contra impactos, ideal para desbastado, lijado y preparación de soldadura por presión. Un resorte ajusta al ADF con firmeza en la parte superior de la carcasa mientras no está en uso.

**INSTRUCCIONES Y LIMITACIONES**  
**Limitaciones importantes:**  
 Estos productos no ofrecen ninguna protección contra riesgos respiratorios ocasionados por procesos de soldadura u otras fuentes. Las Carcasas para soldadura Speedglas™ 3M™ pueden usarse junto con ciertos modelos de respiradores. Para mayores informes sobre protección respiratoria para soldadores, contacte al Servicio Técnico 3M en EE.UU. al 1-800-248-6030, en Canadá al 1-800-287-4414, en México al 01-800-712-0646, o contacte a 3M en su país.  
 Los ADFs Speedglas™ 3M™ no son adecuados para soldadura con láser o procesos de soldadura que requieren lentes de sombra 14 o mayor. El uso de este producto para estas aplicaciones puede ocasionar lesiones permanentes en los ojos y pérdida de la vista.  
 Solo use el ADF en temperaturas entre -5°C (23°F) y +55°C (131°F). Si los usa fuera de este rango, es posible que su desempeño no sea el óptimo, lo que puede ocasionar lesiones permanentes en los ojos y pérdida de la vista.

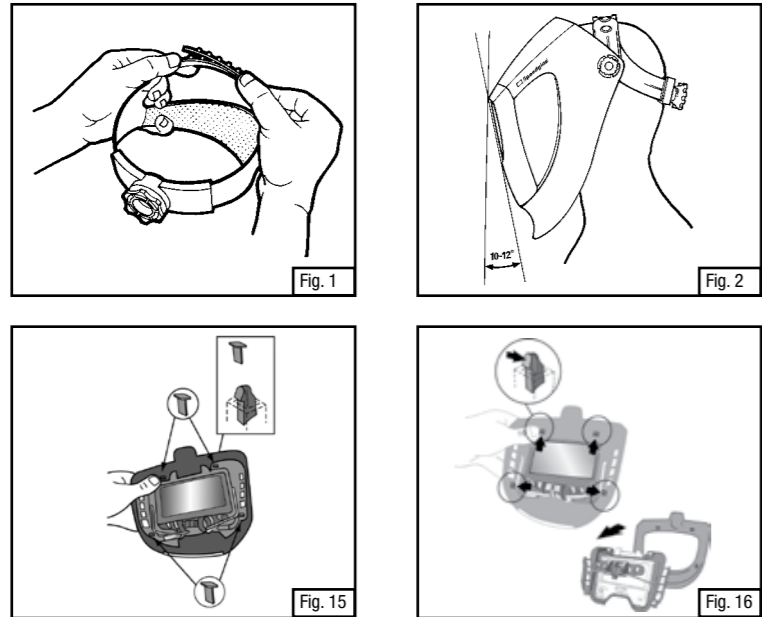

**ESPECIFICACIONES**  
 Tiempo de cambio del ADF

Menos de 0.15 milisegundos (9002 Y y Y)
0.4 milisegundos (9002 D)
0.65 milisegundos (Utility, 9000F y XF)

Estado de luz del ADF  
 Estado apagado del ADF

Sombra 3  
 Sombra 3-6  
 Protección en todo momento – sin cambio (Utility, 10 u 11  
 9002D, 10 y 11  
 9002X, 10, 11 y 12  
 9002A y X, 9, 10, 11, 12 y 13  
 Utility, 9002X, 9002Y, 91 mm x 43 mm x 43 mm (3.57" x 1.68")  
 9002X, 9000E, 104 mm x 54 mm (4.09" x 2.13")

Área de visión:

Peso de carcasas – sin ADF

Utility / 9000	327 g	0.7 lbs.
9000 FV	447 g	1.0 lbs.
9000 HWR	611 g	1.3 lbs.
9000 HWR HV	768 g	1.7 lbs.
ProTop	717 g	1.6 lbs.
ProTop FV	837 g	1.8 lbs.

Las Ventanas laterales agregan 13 g (0.03 lbs.) a los pesos antes mencionados.

Peso de los ADFs, incluidas las micras protectoras

Tamaño X (9002X, 9000X, 9000F)	191 g	0.42 lbs.
Tamaño regular (Utility, 9002D, 9000)	166 g	0.37 lbs.

Temperatura de operación: -5°C a +55°C (23°F a 131°F)

Tipo de batería: Dos baterías de litio CR-2032 3V

Vida de batería: Utility, 9000F, 9002D & 9002X: 2000 horas  
 9000F: 1000 horas  
 9002X: 3000 horas

Temperatura de uso del ADF: -5°C (23°F) a +55°C (+131°F)

Tamaño de cabeza: Tamaño de casco 6.5 (20.25 pulgadas) hasta 7.8 (24.5 pulgadas)

Visor y material del soporte: Poliamida nylon

Carcasa del ADF: Poliamida nylon

**Partes de repuesto de la carcasa**


04-0012-00	Ensamble de carcasa 3M™ 9000, con banda para la cabeza
04-0114-00	Protección interior para carcasa 3M™ 9000, solo visor
04-0014-00	Carcasa Utility 3M™ con banda para la cabeza
04-0114-00	Protección interior para carcasa Utility 3M™
04-0212-00	Panel frontal plateado 3M™
04-0600-00	Banda para la cabeza y hardware de montaje 3M™ 9000
04-0660-00	Banda para la cabeza y perilla con seguro (derecha) 3M™, paquete de 10
04-0026-00	Banda para la cabeza y perilla con seguro (izquierda) 3M™, paquete de 10
04-0126-00	Banda para la cabeza 3M™, velo de algodón con almohadilla
02-0024-00	Banda para el sudor de repuesto 3M™, piel
02-0024-02	Banda para el sudor de repuesto 3M™, laminado de espuma, negra

**Accesorios de la carcasa**

02-0645-00	Cubierta para la cabeza 3M™
15-0098-60	Protector para la garganta y lateral 3M™, piel
02-0660-00	Protector para la garganta 3M™, FR algodón
02-0014-00NR	Adaptador para casco 3M™
02-0023-00	Casco 3M™ con hardware de montaje

**Partes de repuesto de FlexView**

04-0026-00	Banda para la cabeza y perilla con seguro (derecha) 3M™, paquete de 10
04-0126-00	Banda para la cabeza 3M™, velo de algodón con almohadilla
04-0114-00	Protección interior para carcasa FlexView 3M™
04-0114-00	Protección interior para carcasa FlexView 3M™ con ventanas laterales
04-0116-00SW	Micra protectora FlexView 3M™, empaque de 10
04-0361-00	Panel medio de carcasa FlexView 3M™
04-0360-00	Soporte de Lente auto-oscuriente para soldadura FlexView 3M™
04-0216-00	Panel frontal plateado FlexView 3M™

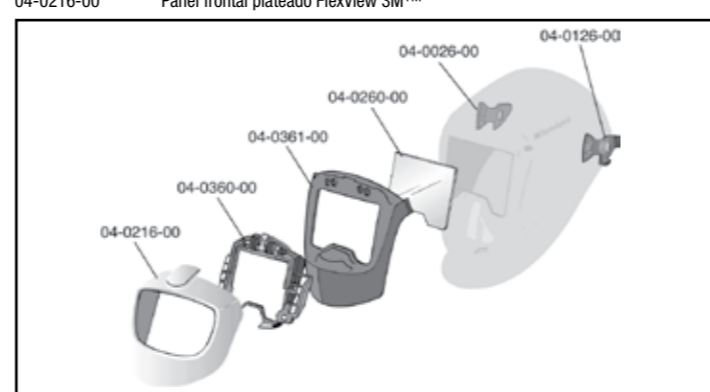

**AJUSTE DE LA CARETA Y LA POSICIÓN DE VISIÓN**  
 1) Ajuste la banda de la cabeza a una de las posiciones de ajuste para lograr el ajuste adecuado de la protección y asegurar el balance y la estabilidad (Fig. 1). La banda para la cabeza también tiene una perilla dentada para aumentar o disminuir su circunferencia.  
 2) Revise si la posición de visión es la correcta. El ángulo de visión recomendado entre la cara y el visor es 10° a 12° (Fig. 2). Para ajustar el ángulo de visión siga las instrucciones del paso 3.  
 3) Coloque la perilla con seguro de la banda para la cabeza de modo que el pasador en el lado de la carcasa para soldadura (Fig. 3) pase por una de las ranuras en el seguro (topo) para obtener el ángulo de visión deseado.

**Operación de encendido / apagado**  
 Para encender el ADF solo pulse el botón ON. El ADF se apagará automáticamente 60 minutos después de la detección del último arco (modo de apagado de sombra 3-6 al estado encendido/apagado de luz de 3). Si el ADF no se cambia repentinamente a modo oscuro, puede haberse activado un desarmador pequeño de cabeza plana. Los soportes de batería se deslizan hacia fuera, al abrir los compartimentos se libera mucha fuerza. Inserte el desarmador más allá de lo necesario. Quite las dos baterías y deséchelas de acuerdo con las regulaciones locales. Introduzca las baterías nuevas (CR-2032, Speedglas™ 3M™, no de parte 04-0302-00) en los soportes de batería (Fig. 11). Mida los soportes en el ADF hasta que queden fijos en su posición. NOTA: Siempre reemplace ambas baterías al mismo tiempo. Vuelva a ensamblar como se describe en la sección "Reemplazo de la mica protectora exterior".

**Instalación del ADF (excepto FlexView – consulte las instrucciones especiales a continuación)**  
 1) Coloque el ADF en la parte superior de la cabeza de modo que las dos lengüetas de retención queden sobre la orilla de la abertura en la cubierta (Fig. 12).  
 2) Empuje la parte superior del ADF hacia adelante de la cubierta hasta que las lengüetas en el soporte estén completamente encajadas en las ranuras de la cubierta (Fig. 13).  
 3) Use una luz trillante para verificar la existencia de fugas de luz alrededor del ADF. Vuelva a instalar según sea necesario. No empiece el proceso de soldadura hasta que haya corregido todas las fugas de luz.

**Desarmado**  
 1) Para quitar el ensamblaje de lente, que consiste del panel frontal, lente 9000 y el soporte de ADF, primero levante en la posición superior de modo que yazca en la parte superior de la carcasa. Después deslice todo el ensamblaje a la izquierda hasta que haya un ruido que indica la posición sin seguro (Fig. 14). Quite el panel frontal del panel medio de la carcasa.  
 2) Quite el soporte del ADF para soldadura FlexView, quite los seguros de hule del interior de las cuatro lengüetas de sujeción (Fig. 15). Junte y apriete las lengüetas superiores y las dos laterales (Fig. 16). Después de esto puede separar el soporte de ADF del panel frontal plateado FlexView.  
 3) Para reemplazar la mica protectora del ADF o las baterías, esto no debe estar montado en el soporte del ADF. Para hacerlo, jalé con suavidad la parte superior del soporte de ADF mientras jalé el ADF en dirección opuesta (Fig. 17). El ADF y el soporte se separarán.  
 4) Para quitar el panel medio de la carcasa FlexView, jalé y despegue una de las orillas superiores de la carcasa (Fig. 18). Después puede quitar la mica protectora FlexView para su reemplazo (Fig. 19).

**Programación de la sensibilidad correcta (ADF 9002Y y Y)**  
 Para encontrar la programación de sensibilidad adecuada, empiece con la programación 2. Esta es la programación correcta para la mayoría de las aplicaciones. Si el filtro no se oscurece bien durante el proceso de soldadura, cambie a la programación 3 o 4 hasta que logre un buen oscurecimiento. Si la sensibilidad está muy alta, es probable que el filtro se oscurezca en respuesta a la luz ambiental. Si el ADF se usa cerca de otros arcos de soldadura, tal vez sea necesario cambiar a la posición 1 para evitar la interferencia de una "falla requerida de activación".


**Programación del retraso**  
 La programación del retraso controla la velocidad a la que el lente regresa al estado claro después de que ha finalizado el proceso de soldadura. Para ver a qué posición está programado, pulse por un momento el botón de retraso. Para seleccionar otra programación mantenga presionado el botón de sombra mientras el LED centellea hasta que indique la programación deseada.  
 Posición 1 – Recuperación rápida a estado claro: Para soldadura eléctrica por punto o soldadura por puntos donde el soldador requiere tener una visión amplia justo después de acabar el proceso de soldadura.  
 Posición 2 – Posición normal.  
 Posición 3 – Recuperación rápida a estado claro: Para aplicaciones de alto amperaje donde la soldadura por fusión se debe enfriar antes de usarse.  
 Posición 4 – Posición normal.

**Reemplazo de la mica protectora exterior**  
 1) Quite el panel frontal plateado y quite una de las esquinas superiores del visor (Fig. 4). Levante la mica protectora exterior del ADF.  
 2) Si aplica, quite la película protectora de ambos lados de la nueva mica protectora. Coloque la nueva mica en su posición, deslice las lengüetas en las dos ranuras del ADF (Fig. 5).  
 3) Coloque el panel frontal plateado en su posición al insertar las dos lengüetas inferiores en las aberturas en la cubierta del visor (Fig. 6). "Enganche" una de las esquinas superiores del panel en el visor. Después, empuje con el dedo la esquina opuesta hasta que quede fija en su lugar (Fig. 7).  
 4) Reemplace la mica protectora inferior.  
 1) Para reemplazar la mica protectora inferior primero levante la mica anterior (Fig. 8).  
 2) Si aplica, quite la película protectora de ambos lados de la nueva mica protectora. Inserte las dos esquinas de un lado de la mica en las "entradas" de la esquina del ADF. Flexione la mica protectora de modo que pueda insertar las otras dos esquinas en las entradas del extremo opuesto (Fig. 9).  
 5) Reemplazo de la lupa  
 Se encuentra disponible una lupa de 4.25 x 2 pulgadas con su distribuidor local, que puede usar con todas las Carcasas para soldadura Speedglas™ 3M™. Solo quite el panel frontal plateado y la mica protectora exterior, coloque la lupa frente al ADF y luego vuelva a instalar la mica protectora exterior y el panel frontal plateado. No se requiere un adaptador o soporte especial.  
 \*Nota: No use lupas que no quepan debajo de la mica protectora. La mica protectora exterior DEBE quedar bien asentada con los dos lengüetas insertadas en las dos ranuras del ADFs (Fig. 5).  
 6) Remoción del ADF / cambio de baterías  
 Las lentes deben reemplazarse cuando la activación de sombra del ADF no sea notable (sombra 5 a

3) cuando está encendido. Además, todos los modelos 9002 tienen un indicador de batería baja que centelleará repetidas veces cuando sea necesario cambiar la batería. Para cambiar la batería quite el panel frontal plateado y luego quite el ADF de la carcasa al levantar las dos lengüetas de la parte superior del ADF (Fig. 10). En el ADF hay dos compartimentos para baterías. Con cuidado abra con un desarmador pequeño de cabeza plana. Los soportes de batería se deslizan hacia fuera, al abrir los compartimentos se libera mucha fuerza. Inserte el desarmador más allá de lo necesario. Quite las dos baterías y deséchelas de acuerdo con las regulaciones locales. Introduzca las baterías nuevas (CR-2032, Speedglas™ 3M™, no de parte 04-0302-00) en los soportes de batería (Fig. 11). Mida los soportes en el ADF hasta que queden fijos en su posición. NOTA: Siempre reemplace ambas baterías al mismo tiempo. Vuelva a ensamblar como se describe en la sección "Reemplazo de la mica protectora exterior".

**INSPECCIÓN**  
 Antes de cada uso revise con cuidado los lentes de soldadura. Las las lentes de vidrio o las micras protectoras agrietadas, pinchadas o rayadas pueden comprometer la protección y reducir la visión. Los sensores del ADF deben mantenerse limpios y sin cubiertas para alinear un desempeño correcto. Revise si el visor tiene grietas y cheque si hay fugas de luz. Debe de reemplazarse de inmediato todos los componentes dañados.

**ADVERTENCIA**  
 Antes de cada uso, realice una inspección de acuerdo con las Instrucciones de uso para asegurarse que todos los componentes están instalados y que funcionan de manera adecuada. El uso de ensamblajes de Carcasa para soldadura 3M™ que no cumplan con estos requerimientos de inspección y que no incluyan partes de repuesto originales Speedglas™ 3M™ puede ocasionar lesiones permanentes en los ojos o pérdida de la vista.  
 No use las lentes para soldadura si están agrietadas, pinchadas o dañadas, ya que estas condiciones pueden comprometer la protección ocular y facial contra impactos y puede permitir el paso de radiación UV e IR dañina, lo que ocasionaría lesiones en los ojos y pérdida de la vista.

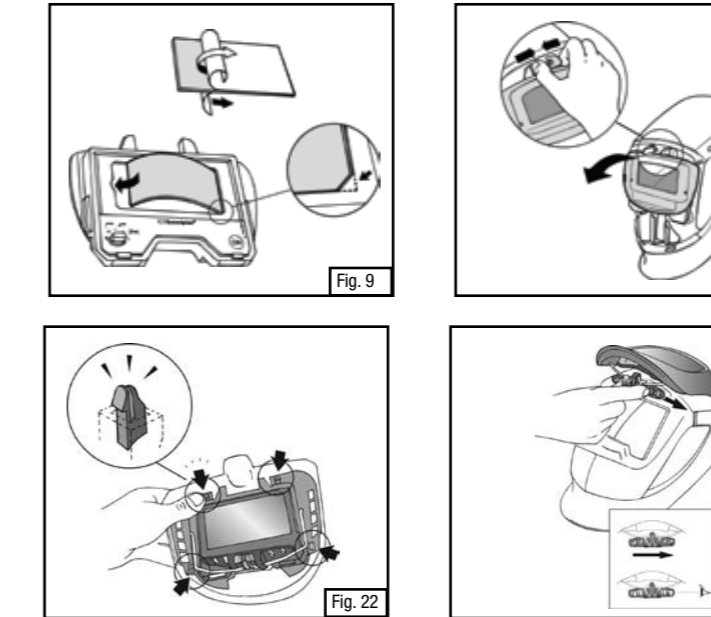

**Revisión del funcionamiento adecuado del ADF:**  
 Bajo condiciones de luz normal, no de soldadura, via a través del ADF y presione el botón de encendido (on). El ADF debe cambiar del estado apagado de sombra 3-6 al estado encendido/apagado de luz de 3. Si el ADF no se cambia repentinamente a modo oscuro, puede haberse activado un desarmador pequeño de cabeza plana. Los soportes de batería se deslizan hacia fuera, al abrir los compartimentos se libera mucha fuerza. Inserte el desarmador más allá de lo necesario. Quite las dos baterías y deséchelas de acuerdo con las regulaciones locales. Introduzca las baterías nuevas (CR-2032, Speedglas™ 3M™, no de parte 04-0302-00) en los soportes de batería (Fig. 11). Mida los soportes en el ADF hasta que queden fijos en su posición. NOTA: Siempre reemplace ambas baterías al mismo tiempo. Vuelva a ensamblar como se describe en la sección "Reemplazo de la mica protectora exterior".

**LIMPIEZA Y ALMACENAMIENTO**  
 Limpie la carcasa para soldadura con jabón neutro y agua tibia. No use solventes. Limpie el lente con una tela o un paño limpio sin pelusa. No sumerja el ADF en agua o lo roce directamente con líquido. Almacene el equipo en un área limpia, seca y sin polvo a temperatura ambiente.

**Tabla 1. Guía recomendada para números de sombra (Adaptado de ANSI Z49.1-2003)**

Operación	Diámetro de electrodo en pulgadas	Corriente de arco en amperes	Sombra de protección mínima	Número de sombra recomendada
Soldadura por arco protegido en gas inerte	< 3	< 60	7	12
	3-5	60-160	8	10
	5-8	160-250	10	10
	> 8	250-350	11	14
Proceso de arco metálico en atmósfera gaseosa	< 3	< 60	7	12
	3-5	60-160	10	10
	5-8	160-250	10	10
	> 8	250-350	10	12
Soldadura por puntos con arco de electrodo de tungsteno en atmósfera inerte	< 3	< 60	7	12
	3-5	60-160	8	12
	5-8	160-250	10	14
Soldadura con electrodo de carbón	< 100	< 500	10	12
	> 100	500-1000	11	14
Corte con plasma de arco eléctrico	< 20	6	6-8	10
	20-100	8	10	10
	100-400	10	12	14
	> 400	11	14	14
Corte con plasma de arco eléctrico	< 300	8	9	9
	300-400	9	12	12
	400-900	10	14	14
Soldadura con soporte	< 300	8	9	9
Soldadura de arco con electrodos de carbono	< 60	7	7	2
	> 60	7	7	14
Corte de plasma de arco eléctrico	< 1.8	4-5	4-5	4-5
	1.8-1/2	5-6	5-6	5-6
	> 1/2	6-8	6-8	6-8
Dicorte	< 1	3-4	3-4	3-4
	1-6	4-8	4-8	4-8
	> 6	5-6	5-6	5-6

**LOCALIZACIÓN A AVERÍAS**

Condición	Soluciones posibles
El ADF no se enciende	Asegúrese de que las baterías estén bien instaladas. Asegúrese del uso de las baterías correctas (CR-2032). Reemplace ambas baterías por unas nuevas, luego revise el indicador de Batería Baja.
El ADF se apaga y no se enciende	Reemplace ambas baterías por unas nuevas, luego revise el indicador de Batería Baja.
El ADF no se activa de manera confiable o cambia intermitentemente durante el proceso de soldadura	Si aplica, revise si la película protectora haya sido removida de ambos lados de la mica protectora exterior. Verifique que los dos sensores en el frente del ADF no estén bloqueados por salpicadura de soldadura, las manos, la cara o los objetos soldados. ¿El modelo que usa es de ADF Speedglas™ 3M™ es el correcto? El ADF Speedglas™ Utility 3M™ no está recomendado para procesos de soldadura que no sean MIG (GMAW) y SMAW. Revise las instrucciones de ajuste de sensibilidad y confirme que está utilizando la configuración correcta para su tipo de proceso de soldadura. Produzca la sensibilidad. Si esto ocurre en la programación 1, use controles o otros métodos para bloquear la luz de otros arcos de soldadura.
El ADF se oscurece cuando otros soldadores están cerca	Revise si el soldador hay procesos en curso o si hay lámparas estroboscópicas de seguridad. Las lámparas estroboscópicas pueden activar el ADF desde una distancia o por el reflejo en el hecho. La luz reflejada de las lámparas estroboscópicas no visible al ojo puede ser lo suficientemente fuerte para activar el ADF.
Activación estable de luz/sombra del ADF sin ningún arco presente	Revise si a su alrededor hay procesos en curso o si hay lámparas estroboscópicas de seguridad. Las lámparas estroboscópicas pueden activar el ADF desde una distancia o por el reflejo en el hecho. La luz reflejada de las lámparas estroboscópicas no visible al ojo puede ser lo suficientemente fuerte para activar el ADF.
El ADF está borroso	Si aplica, revise si la película protectora haya sido removida de ambos lados de la mica protectora exterior.
El ADF tiene salpicadura de soldadura pegada a la superficie de vidrio inferior visor exterior	El ADF tiene daños permanentes y no está dentro de garantía. Siempre use mica protectora exterior y exterior.

**GARANTÍA**  
 En caso de que se compruebe que algún producto de 3M perteneciente a la División OHSESD está defectuoso en el material, la mano de obra, o que no cumple con la garantía, la única obligación de 3M es reemplazarlo o repararlo a su opción. 3M repare, reemplace o reembale el precio de compra de las partes o productos dañados, siempre y cuando 3M haya recibido una notificación al respecto y evidencia de que el producto ha sido almacenado, mantenido y usado de acuerdo con las instrucciones escritas de 3M.  
 EXCLUSIONES A LA GARANTÍA. ESTA GARANTÍA ES EXCLUSIVA Y SE OTORGA EN LUGAR DE CUALQUIER GARANTÍA EXPRESA O IMPLÍCITA DE COMERCIABILIDAD, PERSONALIZACIÓN PARA UN PROPÓSITO PARTICULAR U OTRA GARANTÍA DE CALIDAD, EXCEPTO DE VIOLACIÓN DE PROPIEDAD Y PATENTE.  
 LIMITACIÓN DE RESPONSABILIDAD: Excepto cuando la garantía indique lo contrario, 3M no será responsable por ninguna pérdida, directa o indirecta, incidental, especial o consecutiva, ocasionada por la compra, el uso o el mal uso de los productos, o la incapacidad del usuario de utilizar tales productos. LOS RECURSOS ESTABLECIDOS EN ESTE DOCUMENTO SON EXCLUSIVOS.

3M y Speedglas son marcas registradas de 3M.

**PARA OBTENER MÁS INFORMACIÓN**  
 En español llámenos:  
 Internet: www.3m.com/occafety  
 1-800-712-0646  
 52-70-2552  
 52-70-2152  
 01-800-712-0646

© llame a 3M en su localidad.

